

Safety Data Sheet

D-40

Code : 07-003-1


Prepared By : APC Laboratory

Validation Date : 04-Jan-2021

1. Identification of the substance or mixture and of the supplier

Trade Name	:	D-40
Material Uses	:	Raw material for used in Paint, Ink, manufacturing process solvent, metal working, cleaning agent and degreasing agent.
Supplier	:	Asia Pacific Petrochemical Co., Ltd. 165/14-16 Nirvana at Work Ramintra, Ramintra Road, Anusawari, Bang Khen, Bangkok, 10220 Thailand Telephone: + 66 2 157 1555 Fax: + 66 2 157 1556 www.apcbkk.com
Emergency Contact	:	+66 80 204 6789


2. Hazards Identification

GHS Classification	:	Flammable liquid : Category 3 Skin irritation : Category 3 Specific target organ toxicant (Central nervous system) : Category 3 Aspiration toxicant : Category 1
Signal Word	:	Danger
Health Hazard	:	Harmful may cause lung damage if swallowed. Irritating to skin. Vapours may cause drowsiness and dizziness.
Environmental Hazard	:	Toxic to aquatic organisms. May cause long-term adverse effects in the aquatic environment.
GHS Pictogram	:	
GHS Hazard Statements	:	H226 Flammable liquid and vapour. H304 May be fatal if swallowed and enters airways. H316 Cause mild skin irritation. H336 May cause drowsiness or dizziness.

GHS Precautionary Statements

Prevention	P210	Keep away from heat/sparks/open flames/hot surfaces. -- No smoking.
	P233	Keep container tightly closed.
	P240	Ground / bond container and receiving equipment.
	P241	Use explosion-proof electrical, ventilating and lighting equipment.
	P242	Use only non-sparking tools.
	P243	Take precautionary measures against static discharge.
	P261	Avoid breathing mist/vapours.
	P271	Use only outdoors or in a well-ventilated area.
	P280	Wear protective gloves and eye/face protection.
Response	<u>If swallowed</u>	
	P301+P310	Immediately call a poison center or doctor/physician.
	<u>If on skin</u>	
	P303+P361+P353	Remove/Take off immediately all contaminated clothing. Rinse skin with water/shower.
	<u>If inhaled</u>	
	P304+P340	Remove victim to fresh air and keep at rest in a position comfortable for breathing.
	P312	Call a poison center or doctor/physician if you feel unwell.
	P331	Do not induce vomiting.
	P332+P313	If skin irritation occurs: Get medical advice/attention.
	P370+P378	In case of fire: Use water fog, foam, dry chemical or carbon dioxide (CO ₂) for extinction.
Storage	P403+P233	Store in a well-ventilated place. Keep container tightly closed.
	P403+P235	Store in a well-ventilated place. Keep cool.
	P405	Store locked up.
Disposal	P501	Disposal of contents and container in accordance with local regulations.

Precautionary Pictograms

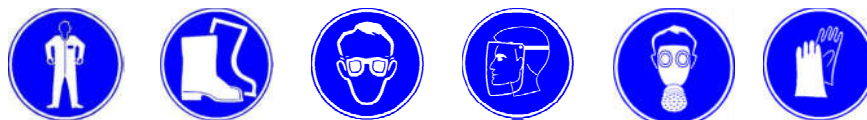

3. Composition/Information on Ingredients

Chemical Name	:	Naphtha (Petroleum), Hydro treated heavy
Common Name	:	D-40
CAS No.	:	64742-48-9
UN No.	:	3295

4. First-Aid Measures

Inhalation	:	Remove to fresh air. If the victim has difficulty breathing or tightness of the chest, give 100% oxygen with rescue breathing or CPR as required and transport to the nearest medical facility.
Skin Contact	:	Remove contaminated clothing. Immediately flush skin with large amounts of water for at least 15 minutes, and follow by washing with soap and water if available.
Eye Contact	:	Immediately flush eyes with large amounts of water for at least 10 minutes while holding eyelids open. Transport to the nearest medical facility for additional treatment.
Ingestion	:	Do not induce vomiting; Do not eat milk and castor oil, transport to nearest medical facility for additional treatment.

5. Fire-Fighting Measures

Suitable extinguishing media	:	Dry chemical powder, Alcohol-resistant foam and Carbon dioxide.
Specific hazard arising from the chemical	:	May produce toxic fumes of carbon monoxide, carbon dioxide if burning.
Special protective action for fire-fighters	:	Keep adjacent containers cool by spraying with water.
Protective Equipment	:	Wear full protective clothing and self-contained breathing apparatus.

6. Accidental Release Measures

Protective Measures	:	<ul style="list-style-type: none">• Observe all relevant local and international regulations.• Avoid contact with spilled or released material. Immediately remove all contaminated clothing. For guidance on selection of personal protective equipment see chapter 8 this Material Safety Data Sheet. Shut off leaks, if possible without personal risks. Remove all possible sources of ignition in the surrounding area. Prevent from spreading or entering drains, ditches or rivers by using sand, earth, or other appropriate barriers.
---------------------	---	---

- Take precautionary measures against static discharge. Ensure electrical continuity by bonding and grounding (earthing) all equipment.

Clean-Up Methods

- ♦ Small spillage (< 200 LT) : Transfer by mechanical means to a labeled, sealable container for product recovery or safe disposal. Allow residues to evaporate or soak up with an appropriate absorbent material and dispose of safely. Remove contaminated soil and dispose of safely.
- ♦ Large spillage (> 200 LT) : Transfer by mechanical means such as vacuum truck to a salvage tank for recovery or safe disposal. Do not flush away residues with water. Retain as contaminated waste. Allow residues to evaporate or soak up with an appropriate absorbent material and dispose of safely. Remove contaminated soil and dispose of safely.

- Other Information : Notify authorities if any exposure to the general public or the environment occurs or is likely to occur. Vapors may form explosive mixtures with air. Vapors may travel to source of ignition and flash back.

7. Handling And Storage

- Handling : Avoid contact with skin, eyes, and clothing. Do not breathe vapours. Extinguish any naked flame. Remove ignition sources. Avoid sparks. Do not smoke. The vapour is heavier than air spreads along the ground and distant ignition is possible. Ensure electrical continuity by bonding and grounding (earthing) all equipment. Do not use compressed air for filling, discharging, or handling operations. Handle and open container with care in well-ventilated area. Do not empty into drains.
- Storage : Must be stored in a diked (bonded) well-ventilated area, away from sunlight, ignition sources and other sources of heat. Bulk storage tanks should be diked (bonded). Keep away from aerosols, flammables, oxidizing agents, corrosives. Storage Temperature: Ambient.
- Product Transfer : Keep containers closed when not in use. Do not use compressed air for filling, discharging, or handling operations. If positive displacement pumps are used, these must be fitted with a non-integral pressure relief valve. Ensure electrical continuity by bonding and grounding (earthing) all equipment.
- Recommended Materials : For containers, or container linings use mild steel, stainless steel.
- Additional Advice : Containers even those that have been emptied, can contain explosive vapours. Do not cut, drill, grind, weld or perform similar operations on or near containers.

8. Exposure Controls and Personal Protection

- Exposure Standard : Occupational Exposure Limits
 - RCP-TWA = 1200 mg/m³

Engineering Controls Workplace	:	Provide exhaust ventilation or other engineering controls to keep the airborne concentrations of vapours below their respective threshold limit value.
Respiratory Protection	:	Vapor respirator. Be sure to use an approved/certified respirator or equivalent. Wear appropriate respirator when ventilation is inadequate.
Hand Protection	:	Butyl rubber gloves, Nature rubber gloves, Neoprene rubber gloves, Nitrile rubber gloves.
Eye Protection	:	Chemical splash goggles (chemical monogoggles).
Other Protection	:	Use protective clothing which is chemical resistant to this material. Safety shoes and boots should also be chemical resistant.

9. Physical and Chemical Properties

Appearance	:	Clear liquid
Odour	:	Mild petroleum
pH Value	:	N/A
Boiling Point (°C)	:	147 - 199 °C
Melting Point (°C)	:	N/A
Flash Point	:	>40 °C (ASTM D56)
Evaporating Rate	:	0.11 (n-Butyl Acetate = 1)
Lower/Upper Flammability limits	:	0.6 - 7.0 %V
Vapour Pressure (kPa)	:	0.21 kPa (1.57 mmHg) @ 20 °C
Density (g/cm ³)	:	0.760 - 0.800 @ 15 °C (ASTM D4052)
Vapour Density	:	>1 @ 101 kPa (Air = 1)
Solubility in Water	:	Negligible
Auto Ignition Temperature	:	>200 °C

10. Stability and Reactivity

Chemical Reactivity	:	Stable under normal conditions.
Stability	:	Stable under normal conditions.
Hazardous Polymerisation	:	No.
Conditions to Avoid	:	Heat, flame, spark and other ignition sources.
Materials to Avoid	:	Strong oxidizing agents.

Hazardous Decomposition Products : Thermal decomposition is highly dependent on conditions. Carbon monoxide, carbon dioxide and other organic compounds will be evolved when this material undergoes combustion or thermal or oxidative degradation. May form explosive peroxides.

11. Toxicological Information

Acute Toxicity

- ◆ **LD₅₀ Acute oral toxicity** : >2,000 mg/kg , (rat)
- ◆ **LD₅₀ Acute dermal toxicity** : >2,000 mg/kg , (rat)
- ◆ **LC₅₀ Acute inhalation toxicity** : Greater than near-saturated vapour concentration/4 hours , (rat)

Skin Irritation : Irritating to skin. Prolonged/repeated contact may cause defatting of the skin which can lead to dermatitis.

Eye Irritation : Irritating to eyes.

Respiratory Irritation : Inhalation of vapours or mists may cause irritation to the respiratory system.

Carcinogenicity : No data available.

12. Ecological Information

Acute Toxicity

- ◆ **Fish** : Practically non toxic: LL/EL/IL₅₀ > 100 mg/l
- ◆ **Aquatic Invertebrates** : Practically non toxic: LL/EL/IL₅₀ > 100 mg/l
- ◆ **Algae** : Practically non toxic: LL/EL/IL₅₀ > 100 mg/l
- ◆ **Microorganisms** : Practically non toxic: LL/EL/IL₅₀ > 100 mg/l

Mobility : Floats on water. If product enters soil, it will highly mobile and may contaminate groundwater.

Persistence / Degradability : Readily biodegradable.

Bio-accumulation : Has the potential to bioaccumulate.

13. Disposal Considerations

Material Disposal : Recover or recycle if possible. It is the responsibility of the waste generator to determine the toxicity and physical properties of the material generated to determine the proper waste classifications and disposal methods in compliance with applicable regulations.

Container Disposal : Drain container thoroughly. After draining, vent in a safe place away from sparks and fire. Refer to Section 7 before handling the product or containers. Residues may cause an explosion hazard. Do not puncture, cut or weld uncleaned drums. Send to drum recovered or metal reclaimed.

Local Legislation : Disposal should be in accordance with applicable regional, national, and local laws and regulations. Local regulations may be more stringent than regional or national requirements and must be complied with.

14. Transport Information

Road/Rail Transport ADR/RID

◆ UN. Number : 3295
◆ Class/Item : 3
◆ Hazard Symbol : Flammable Liquid
◆ Proper Shipping Name : Hydrocarbons, Liquid, N.O.S.
◆ Packing Group : III

Maritime Transport IMO

◆ UN. Number : 3295
◆ Class : 3
◆ Packing Group : III
◆ Hazard Symbol : Flammable Liquid
◆ Proper Shipping Name : Hydrocarbons, Liquid, N.O.S.
◆ Marine Pollutant : No

Air Transport IATA/ICAO


◆ UN. Number : 3295
◆ Class : 3
◆ Packing Group : III
◆ Hazard Symbol : Flammable Liquid
◆ Proper Shipping Name : Hydrocarbons, Liquid, N.O.S.

15. Regulatory Information

EC Label Name : D-40, Naphtha (Petroleum), Hydro treated heavy
EC Classification : Flammable Liquid
EINECS (EC) : 265-150-3

16. Other Information

National Fire Protection
Association (USA)

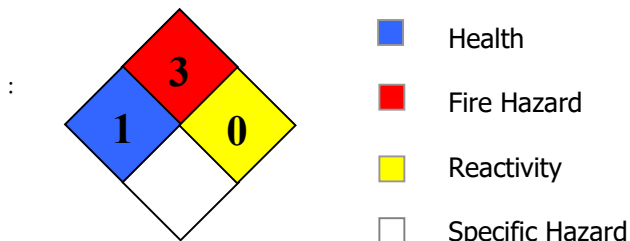

SDS Distribution

: The information in this document should be made available to all who may handle the product.

Prepared By

: Quality Control Department.
Asia Pacific Petrochemical Co., Ltd.

Disclaimer :

The information contained herein is based on our current knowledge of the underlying data and is intended to describe the product for the purpose of health, safety and environmental requirements only. No warranty of guarantee is expressed or implied regarding the accuracy of these data or the results to be obtained from the use of the product.

Revision 3 : January, 2021